

# Service Bulletin

**Priority RED**

No 14 rev 3 2008-04-08

## Non return valves for protection of air distributor CD Units.

### **Background:**

We have experienced damaged to the air distributor in the electric cabinet caused by water penetration on some vessels. This has been caused by leakage of the non return valve #137 on the circulation tank #52. See picture below:



Non return valve #137  
16101

### **Corrective actions:**

In order to avoid and correct this problem Marinfloc recommend that the non-return valve is checked for leakage and replaced if necessary. Marinfloc also recommend that an extra non return valve is added to the hose after the air adjustment valve #136 for extra safety. See picture below:




4mm non return valve  
47206

Non return valve ¼" #137 article number: 16101

Non return valve 4mm for hose article number: 47206

If you have a CD unit which is not equipped with this 4mm non return valve for hose or with thread see picture below Marinfloc AB will supply one free of charge ex. Works, Varekil Sweden

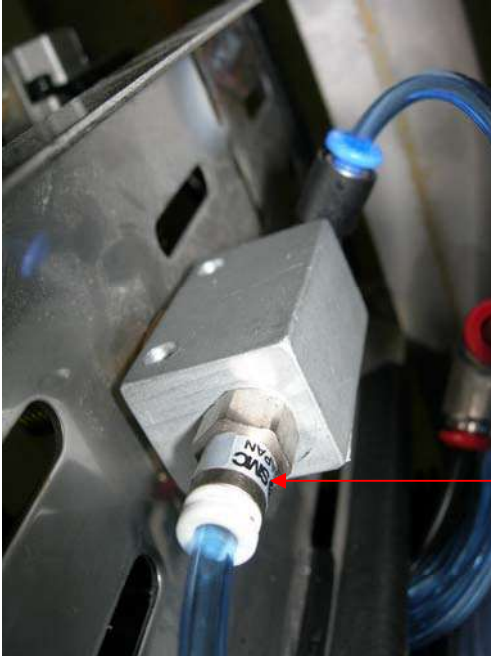

4mm non return valve  
with thread 47207

All the previous service bulletins and other important information, as e.g. updated lists of approved chemical and flocculants, can be found on our website: [www.marinfloc.com](http://www.marinfloc.com)

**Don't hesitate to contact us if you have any questions or problems!**

You can easily reach us by phone: +46 (0)304-606 300, fax +46-(0)304-100 51 or via e-mail to [service@marinfloc.com](mailto:service@marinfloc.com).

*-Our mission is clear ~ a clean sea!-*